## പതിനാലാം കേരള നിയമസഭ പതിനാറാം സമ്മേളനം

നക്ഷത്രചിഹ്നമിടാത്ത ചോദ്യം നം.1169 31.10.2019 ൽ മറുപടിക്ക്

എ)

### പാലാരിവട്ടം പാലത്തിന്റെ ബലക്ഷയം

#### ചോദ്വാ

### ശ്രീ.സണ്ണി ജോസഫ്

എ) പാലാരിവട്ടം പാലത്തിന്റെ ബലക്ഷയം സംബന്ധിച്ച് ചെന്നൈ ഐ.ഐ.റ്റി.യിലെ വിദഗ്ദർ പരിശോധന നടത്തിയിരുന്നോ; പ്രസ്തുത വിദഗ്ദരുടെ ശിപാർശ എന്തായിരുന്നു വെന്ന് വ്യക്തമാക്കാമോ;

ബി) പ്രസ്തുത പാലം പൂർണ്ണമായും പൊളിച്ച് നീക്കി പുതിയത് പണിയണമെന്ന ശിപാർശ അവർ നൽകാത്ത സാഹചര്യത്തിൽ പാലം പൊളിച്ച് നീക്കുവാനുള്ള തീരുമാനം കൈക്കൊണ്ടത് എത്തകൊണ്ടാണെന്ന് അറിയിക്കാമോ; ഉത്തരം ശ്രീ.ജി.സുധാകരൻ (പൊതുമരാമത്തും രജിസ്ലേഷനം വകപ്പ് മത്ത്രി)

പാലാരിവട്ടം പാലത്തിന്റെ ബലക്ഷയം സംബന്ധിച്ച് ചെന്നൈ ഐ.ഐ.റ്റി.യിലെ വിദഗ്ധർ പരിശോധന ഫൈനൽ ഐ.ഐ.റ്റി നടത്തിയിരുന്നു. അനുബന്ധമായി ശുപാർശകൾ റിപ്പോർട്ടിലെ ഡോ.ഇ.ശ്രീധരനെ ഇതോടൊപ്പം ചേർക്കുന്നു. അടിസ്ഥാനത്തിൽ ചുമതലപ്പെടുത്തിയതിന്റെ ഉപയോഗിച്ച നടത്തിയ പരിശോധന വിദഗ്ധരെ ഈ രണ്ട് റിപ്പോർട്ടുകളം ലഭിച്ചിട്ടണ്ട്. റിപ്പോർട്ടം നൽകാൻ ചീഫ് വിലയിരുത്തി വിദഗ്ധാഭിപ്രായം എഞ്ചിനീയർമാർ അടങ്ങുന്ന വിദഗ്ധ സമിതിയെ .സമിതിയുടെ സർക്കാർ നിയോഗിച്ചിരുന്നു. ത്ത റിപ്പോർട്ടും ഇക്കാര്യത്തിൽ പരിഗണിച്ചിട്ടുണ്ട്.

പാലാരിവട്ടം പാലത്തിന്റെ ബലക്ഷയം സംബന്ധിച്ച് റിപ്പോർട്ട് യൂടെ -ഐ.ഐ.റ്റി ചെന്നെ അഡ് ഡി.എം.ആർ.സി പ്രിൻസിപ്പൽ വൈസർ ഡോ.ഇ.ശ്രീധരൻ പരിശോധിച്ച് സമർപ്പിച്ച റിപ്പോർട്ട് നിർദ്ദേശങ്ങൾ പരിഗോധിച്ച് എന്നിവ സമർപ്പിക്കാനായി രൂപീകരിച്ച വിദഗ്ധ സാങ്കേതിക സമിതിയുടെ ശുപാർശ പ്രകാരമുള്ള നടപടിയാണ് കൈക്കൊണ്ടത്. അതിന പ്രസ്തത വിഷയത്തിൽ പ്രവൃത്തികൾ അനസരിച്ചുള്ള റീഹാബിലിറ്റേഷൻ ജനങ്ങൾക്ക് പ്രയോജനപ്പെടുന്ന നടത്താനും നിലനിൽക്കണ ദീർഘകാലം വിധത്തിൽ മെന്നതിനുമാണ് സർക്കാർ പ്രാധാന്യം നൽകന്നത്.

Tommonalmub-1



**Professor** 

## Dr. P. Alagusundaramoorthy

## STRUCTURAL ENGINEERING LABORATORY CIVIL ENGINEERING DEPARTMENT

Indian Institute of Technology Madras, Chennai - 600 036, India.

**≅**: 044 - 2257 4276

Fax: 044 - 2257 0545 Email: aspara0@iitm.ac.in

12-09-2019

The Managing Director,

Roads and Bridges Development Corporation of Kerala Ltd.,

Report III dt. 05-09-2019.

2<sup>nd</sup> Floor, Preethi Building, M.V. Road, Palarivattom, Kochi - 682 024, Kerala State.

Sir,

Sub: Design and Construction of Palarivattom Flyover in in NH66 (Old NH 47) By pass - Rectification Works - Reg.

Ref: Repair and Rehabilitation Procedures for Girders and Pier Caps - HT Madras

Please refer the above reference. The following procedures using Concrete Jacketing shall be used to repair and flexural and shear strengthening of precast RC Girders (instead of carbon fiber wrapping for shear strengthening of Girders) and Pier Caps in the flyover at NH-66, Palarivattom, Kochi:

(i) Flexural Strengthening of Precast RC girders by Concrete Jacketing (Report III, Page 10, Sec. 5.0).

(ii) Shear Strengthening of Precast RC girders by Concrete Jacketing Additional stirrups using 10mm dia. TMT steel rebars at a spacing of 200mm c/c shall be added by concrete jacketing to increase shear capacity of girders. The cover concrete on girders upto a length of 5500 mm from the diaphragm beams (both ends) have to be removed/roughened and steel rods exposed. The prepared surfaces shall be cleaned from dust and debris. The position of additional stirrups (Fig. 11) has to be marked on the girders. Additional stirrups shall be anchored into the deck slab as shown in Fig. 12 using anchoring grout. 10mm dia. 150 mm depth TMT steel rebars (shear keys) at a spacing of one meter interval in a staggered manner shall be fixed (Fig. 12). Water tight shuttering shall be provided in two stages. Shrinkage compensated free flowing micro-concrete which attains a compressive strength of 35 N/mm<sup>2</sup> in three days shall be poured in to the corresponding shuttering. Deck slabs need not be drilled for pouring micro-concrete. Side shuttering shall be removed after three days. Bottom shuttering shall be removed after 7 days. Proper curing to be done as per the manufacturers catalogue for micro-concrete. The process of shear strengthening shall be done in parallel with the flexural strengthening (Report III, Page 10, Sec. 5.0) of girders.



- (iii) Cross Stiffening of Precast RC Girders (Report III, Page 8, Sec. 4.0)
- (iv) Repair and Strengthening of Pier Caps (Report III, Page 11, Sec. 6.0)

The estimated cost to repair and strengthen the flyover by concrete jacketing is given in Table 3.0. The flexural strengthening and shear strengthening of precast RC Girders and Pier caps can be done by Concrete Jacketing.

Table 3. Repair and Strengthen the Flyover using Concrete Jacketing

| SL<br>No.                                    | Repair and Strengthening Item and Technique                          | Cost (Rs./Crores) |
|--|--|-------------------|
| 1.   | Flexural strengthening of precast RC girders by concrete jacketing   | 3.17              |
| <u>.                                    </u> | Shear strengthening of precast RC girders by concrete jacketing      | 1.30              |
| 3.   | Cross stiffening of precast RC girders using standard steel sections | 1.20              |
| 4.   | Repairing of cracks in precast RC girders by resin injection         | 0.28              |
| 5.   | Repairing of cracks in RC retaining walls at abutments               | 0.10              |
| 6  | Repair and strengthening of pier caps including the cracks           | 1.08              |
|  | Total  | 7.13              |

Total duration: 9 months.

(v) Overall View of Carbon Fiber Fabric Composites

The applicators guarantee period for carbon fiber fabric composites is ten years. Carbon fiber fabric composites will never corrode. They cannot be affected by any chemical environment. Carbon fiber fabric composites will last for a longer period than the guarantee period. If carbon fiber fabric composite wrapping is damaged accidentally, it can be repaired easily. Since carbon fiber fabric composites on an average four times stronger than steel and four times lighter than steel, they are selected for shear strengthening of girders in order to reduce the repair time and additional dead load on Pier Caps. Carbon fiber wrapping is one of the procedures for shear strengthening of RC Girders. If not preferred, shear strengthening of RC Girders shall be done by the conventional concrete jacketing as explained above in Sec. (ii).

IIT Madras will issue the execution drawings as per the requirement. Scaffolding, water supply and power supply have to be provided as per the site conditions by RBDCK/RDS. After repair and strengthening a span and two pier caps, a load test to be conducted and the measured deflection can be checked with the allowable limit to ensure the safety of the bridge. Strict quality control to be ensured during the repair and strengthening of Flyover. All safety procedures for manpower and machines to be ensured by the Applicators.

Thanking you

Dr. P. ALAGUSUNDARAMOORTHY Professor Structural Engineering Laboratory Civil Engineering Department Indian Institute of Technology Madras Chennal - 600 036, India

Dr. P. Alagusundaramoorthy)

12.09.2019

# CONDITION ASSESSMENT AND REPAIR AND REHABILITATION OF FLYOVER AT PALARIVATTOM IN NH66

#### Report III

Repair and Rehabilitation Procedures for Girders and Pier Caps RB/18-19/CIE/014/ROAS/PALA

Client

ROADS AND BRIDGES DEVELOPMENT CORPORATION KERALA LIMITED

Kerala

Consultant

Prof. P. Alagusundaramoorthy



STRUCTURAL ENGINEERING LABORATORY
CIVIL ENGINEERING DEPARTMENT
INDIAN INSTITUTE OF TECHNOLOGY MADRAS
CHENNAI - 600 036

#### **CERTIFICATE**

The details of repair and rehabilitation procedures for the precast RC girders and pier caps in the flyover in NH-66 at Palarivattom, Kochi, and the cost estimation are given in this report



Dr. P. Alagusundaramoorthy)

03. 09. 2019

Dr. P. ALAGUSUNDARAMOORTHY
Professor
Structural Engineering Laboratory
Civil Engineering Department
Indian Institute of Technology Madras
Chennal - 600 036, India

## CONDITION ASSESSMENT AND REPAIR AND REHABILITATION OF FLYOVER AT PALARIVATTOM IN NH66

#### Report III

Repair and Rehabilitation Procedures for Girders and Pier Caps
RB/18-19/CIE/014/ROAS/PALA

Client

ROADS AND BRIDGES DEVELOPMENT CORPORATION KERALA LIMITED

Kerala

Consultant

Prof. P. Alagusundaramoorthy



STRUCTURAL ENGINEERING LABORATORY
CIVIL ENGINEERING DEPARTMENT
INDIAN INSTITUTE OF TECHNOLOGY MADRAS
CHENNAI - 600 036

#### LIST OF TABLES

| alde<br>No | Title   | Page<br>No. |
|------------|---|-------------|
| i          | Repair and Strengthen using NSM Technique     | 12          |
| •          | Rapan and Strengthen using Concrete Jacketing | 12          |

#### CONTENTS

| St. Description  | No.       |
|--|-----------|
| Certificate  | ii        |
| Contents   | iii       |
| List of Tables   | iv        |
| List of Figures  | v         |
| 10 INTRODUCTION  | 1         |
| IN REPAIR AND STRENGTHENING OF FLYOVER                               | 2         |
| 21 Near Surface Mounting Technique                                   | 3         |
| 2.2 Concrete Jacketing   | 3         |
| VO REPAIRING AND STRENGTHENING OF PRECAST RC GIRDERS                 | -         |
| USING NSM TECHNIQUE  | 3         |
| 1.1 Repairing of Cracks  | 3         |
| 1.2 Flexural Strengthening of RC Girders using CFRP Composite Rebars | 1 3       |
| V. V. Shear Strengthening of RC Girders                              | 5         |
| 4.0 CROSS STIFFENING OF RC PRECAST GIRDERS                           | 7         |
| 10 FLEXURAL STRENGTHENING OF PRECAST RC GIRDERS BY                   |           |
| CONCRETE JACKETING   | 9         |
| THE REPAIR AND STRENGTHENING OF PIER CAPS                            | 10        |
| 10 ESTIMATED COST FOR REPAIR AND STRENGTHENING OF FLY                | OVER   12 |
| 7.1 Cost Estimate to Repair and Strengthen Using NSM Technique       | 12        |
| 7.2 Cost Estimate to Repair and Strengthen Using Concrete Jacketing  | 13        |
| NEW SUMMARY AND RECOMMENDATIONS                                      | 1         |

## CONDITION ASSESSMENT AND REPAIR AND REHABILITATION OF FLYOVER AT PALARIVATTOM IN NH66

#### 1 0 DO RODUCTION

the Cameral Manager (i/c), Roads and Bridges Development Corporation of Kerala Limited (HIIII K) asked III Madras to inspect the distressed flyover in NH 66 at Palarivattom. Kochi and to agrees the existing condition of the flyover, scrutinize the structural design to identify defliciency in design and construction if any, recommend suitable rectification with and identify the lapses if any on the part of Contractor and Consultant (HHDCK/1-123/Vol. 4/883, ltr. dt. 04.06.2018). Dr. P. Alagusundaramoorthy, Professor, and Rujasekaran, Senior Project Officer, Structural Engineering Laboratory, t Ivil Engineering Department, HT Madras visited Kochi on 01-08-2018 and inspected the Hyuvet at Palarivattom in NH 66. Mr. Alex T Joseph, GM (i/c), Ms. Lissey, AGM, Me Maya M.J. Senior Manager, Mr. Shalimar M.S, Senior Consultant, Mr. Pramod G, JGM and Mr Antony Shyam, Senior Planning Engineer, RDS were present during the inspection of the flyover. Flexural, shear and flexural shear cracks are noticed on the precast RC girders In almost all spans. Structural cracks are observed on certain pier caps. One of the pot bearing at the No 1918 has failed. Certain neoprene bearing pads are also distressed. The bitumen real on the flyover debonded. Settlement of embankment on the expansion joint at Pier No. 11 le noticed. Vertical cracks are noticed on certain portions of the RC wall of the mulunkment. From the preliminary inspection, it is noted that the flyover is in distress.

III Madras suggested to RBDCK to conduct NDTs and PDTs and check the structural design of the superstructure and foundation with the existing strength of concrete. IIT Madras asked HIHE k to repair and rehabilitate the flyover as early as possible. IIT Madras submitted the proposal to scrutinize the structural design to identify any deficiency in the design of flyover, conduct the non-destructive tests (NDTs) such as Ultrasonic Pulse Velocity (UPV) and behinde Rebound Hammer Number tests on selected thirteen RC girders and four piers, struct concrete cores from thirteen RC girders, four piers and RC walls of embankment, support suitable repair and rehabilitation/strengthening procedures along with materials and specifications, prepare BOQ for repair and rehabilitation of the flyover and as per the reputement check the quality of repair materials and periodical inspection of the repair and rehabilitation works. The proposal sent by IIT Madras was approved by RBDCK and III Madras commenced the subject scope of work. The details of testing and conclusions

#### LIST OF FIGURES

| l'Ignre<br>No. | Title   | Page<br>No. |
|----------------|---|-------------|
| 1              | Layout of CFRP Composite Rebars for Flexural Strengthening of Girders   |             |
|                | using NSM Technique   | 4           |
| )              | Position of Groovesland CFRP Composite Rebars in the Cross Section of a |             |
|                | Girder  | 4           |
| 1              | Luyout of Carbon Fiber Fabric in a Girder for Shear Strengthening       | 6           |
| 4              | Honded Carbon Fiber Fabric in the Cross Section of a Girder             | 6           |
| 1              | Luyout of Steel Cross Girders in a Span                                 | 7           |
| Ų              | Position of Steel Cross Girders in between the Longitudinal Girders     | 8           |
| y              | Connection Details of Steel Cross Girders with Precast RC Girders       | 8           |
| Ħ              | Flexural Strengthening of Girders by Concrete Jacketing                 | 9           |
| ij             | Additional Steel Reinforcements at the Top of Pier Cap                  | 11          |
| 10             | Additional Steel Reinforcements at the Bottom of Pier Can and Stirrups  | 11          |

#### t 1 Near Surface Mounting Technique

the analysticing thening of RC girders by NSM technique using CFRP composite rebars, shear to applicular using carbon fibre fabric composites and arresting the cracks by injecting low transcriptory vinyl ester resin.

#### 11 Concrete Jacketing

the small strengthening by adding additional steel reinforcements at the bottom of precast RC guide to using shear keys and microconcrete, shear strengthening using carbon fibre fabric composites and arresting the cracks by injecting low viscous epoxy vinyl ester resin.

## THREPAIRING AND STRENGTHENING OF PRECAST RC GIRDERS USING NAM TECHNIQUE

#### 1.1 Repairing of Cracks

th min dia and 125 mm deep holes have to be drilled at a spacing of 350 mm c/c at Now in crack length) along the crack length and 6 mm dia. 75 mm length nozzles to be then turing croxy putty. Low viscous epoxy vinyl ester resin has to be pumped under presente till refusal. The nozzles have to be cut after grouting and finished with fast setting pulymer mortar.

## 11 Flexural Strengthening of RC Girders Using CFRP Composite Rebars

How numbers of 32 mm dia. CFRP composite rebars having a tensile strength of 1800 N/mm and tensile modulus 2.1 x 10<sup>5</sup> are to be added to the bottom of the girders. It moves of size 48 mm x 48 mm at a spacing of 118mm c/c have to be cut at the bottom concrete. The grooves have to be cleaned from dust. A layer of adhesive epoxy resing the kept in position below the layer of resin and the entire length of groove be filled with at the groove resin. Excess resin has to be wiped out and the bottom surface to be levelled with trovel in line with the bottom cover concrete. Proper packing using wooden planks and the packing be removed for air curing of the resin (as per modulations data) and the packing be removed for air curing of resin. The schematic beginning they are the proper packing using wooden planks and the packing be removed for air curing of resin. The schematic beginning they are the proper packing in a girder is shown in Fig. 1. The size and the proper packing they are the proper packing of resin. The schematic beginning they are the proper packing in the cross section of a girder are

the analysis of the flyover and conclusions arrived from the analysis are given in Report 2. The repair and retrofitting (strengthening) of precast RC products a ross stiffening of precast RC girders and repair and strengthening of Pier caps are precautiful this report. The cracks on RC walls at the abutments have to be repaired. The condition of pedestals and POT CUM PTFE bearings in the obligatory PSC girder (Center) upon 191 into have to be checked and the pedestals to be repaired/recast and the bearings be toplaced it needed.

#### LOUPPAIR AND STRENGTHENING OF FLYOVER

His throver consists of seventeen standard spans with precast RC girders and two obligatory with PSC girders supported on two abutments AP1 and AP2 and eighteen piers (P1 to P18). Unch attendard span consists of six precast RC girders connected to two end diaphragm beating aupported by bearing pads on the pier caps. Based on the non-destructive and partially destructive texts and analyses, IIT Madras suggested to repair and strengthen the precast RC windows in seventeen standard spans and pier caps in eighteen piers P1 to P18. All precast RC windows to be strengthened for (i) flexure to enhance the effective moment of inertia and thereby reduce the deflection and (ii) shear to account for the increase in shear capacity due to the trengthening. The flexural, shear and flexural shear cracks on the girders to be introduced. The flexural and shear cracks in the Pier caps to be arrested. All Pier caps to be trepatively and strengthened for both flexure and shear deficiency.

Madina explored the possibility of repairing and strengthening the precast RC girders nature (I) Concrete jacketing, (ii) Steel jacketing, (iii) External flexural strengthening using CHP composite pultruded sheets, (iv) Strengthening of girders by near surface mounting CNAM technique using CFRP composite pultruded sheets, (v) Strengthening of girders by NAM technique using pultruded CFRP composite rebars and (vi) Shear strengthening using contact titue fabric composites. The possibility of repairing and strengthening the Piers using that action fibre fabric composites and (ii) and Concrete jacketing are also explored.

t amplicating the durability, cost and time to repair and strengthen the precast RC girders the following two schemes such as (i) Near Surface Mounting Technique and (ii) Concrete to be truly are preferred:

#### UNShear Strengthening of RC girders

current fibre fabric of 230 gsm having a width of 500 mm shall be used for shear strengthening of girders to have additional shear capacity due to increase in flexural strengthening of girders under NSM technique. Ten pieces of carbon fibre fabric upto a size of 4000 mm x 500 mm ( $\ell$  x b) have to be cut and kept ready. The concrete substrate on the grader upto a length of 5500 mm from the diaphragm beams (both ends) have to be roughened by small blasting/wire brush and cleaned from dust and debris. The position of 'U' wraps has to be marked on the girders. A layer of epoxy primer to be applied on the prepared (toughened) concrete substrate. After the tack free time of primer, a layer of catalysed subtrating epoxy resin to be applied on the primer coat and the fabric be bonded on the catalysed resin. Another layer of catalysed epoxy resin to be applied on the fabric for proper worting and bonding. Serrated rollers be used to remove the air bubbles and proper bonding of curbon fibre fabric. All 'U' wraps shall be bonded (anchored) on the deck slab upto 100 mm on both ends. The schematic diagram of 'U' wraps in a girder is shown in Figs. 3 and 4

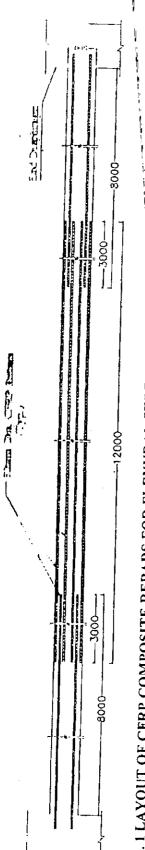


FIG. 1 LAYOUT OF CFRP COMPOSITE REBARS FOR FLEXURAL STRENGTHENING OF GIRDERS USING NSM TECHNIQUE

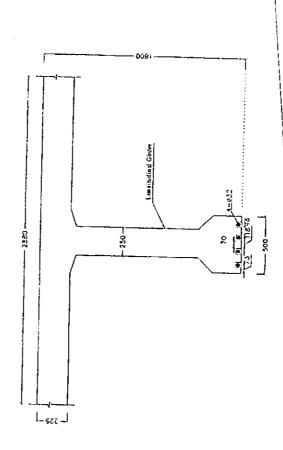


FIG. 2-POSITION OF GROOVES AND CFRP COMPOSITE REBARS IN THE CROSS SECTION OF A GIRDER -Fig.-2

### 4.0 CROSS STIFFENING OF RC PRECAST GIRDERS

Apart from the two end diaphragm beams, all precast RC longitudinal girders in the seventeen standard spans have to be cross stiffened at a distance of 5.063 m ( $\ell$ /4), 10.125 m ( $\ell$ /2) and 15.188 m ( $3\ell$ /4) from any one of the end diaphragm beams for lateral stability and control of vibration. The cross girders shall be integrated to the deck slab using shear keys. Steel girders of ISWB 600 @ 145.1 kg/m shall be used for cross stiffening. The length of each cross girder in between the longitudinal precast RC girders is 2630 mm. Steel plates of size 700 mm x 400 mm x 20 mm thick shall be used for connecting the steel girders with RC girders. The end plates and two ends of the cross girders shall be fabricated in line with the longitudinal girders suitable for connections. 8 nos. of 20 mm dia. bolts shall be used for connecting the steel cross girders to the longitudinal precast RC girders. The schematic diagram of layout of steel cross girders and the connections are shown in Figs. 5, 6 and 7.

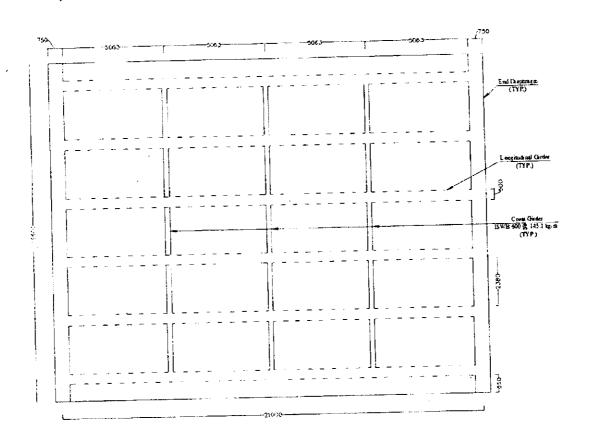
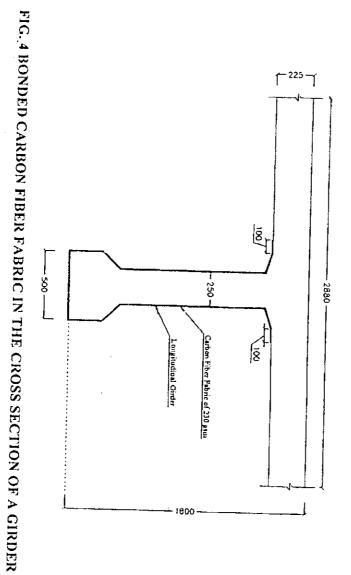


FIG. 5 LAYOUT OF STEEL CROSS GIRDERS IN A SPAN





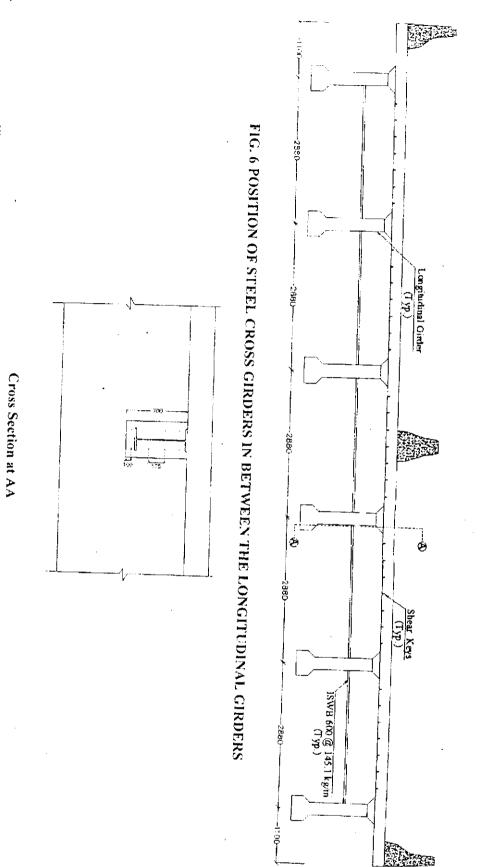


FIG. 7 CONNECTION DETAILS OF STEEL CROSS GIRDERS WITH PRECAST RC GIRDERS

# 5.0 FLEXURAL STRENGTHENING OF PRECAST RC GIRDERS BY CONCRETE JACKETING

The bottom cover concrete (50 mm thick) on RC girders shall be removed and cleaned from loose materials. 4 nos. 32 mm dia. TMT steel rebars shall be added as additional reinforcements to the existing reinforcements using U shaped shear keys of 10 mm dia. at a spacing of 200 mm c/c. Water tight shuttering to be provided and microconcrete shall be poured. Bottom shuttering shall be removed after 7 days. Proper curing to be done as per the manufacturers catalogue for microconcrete. The schematic diagram of concrete jacketing is shown in Fig. 8.

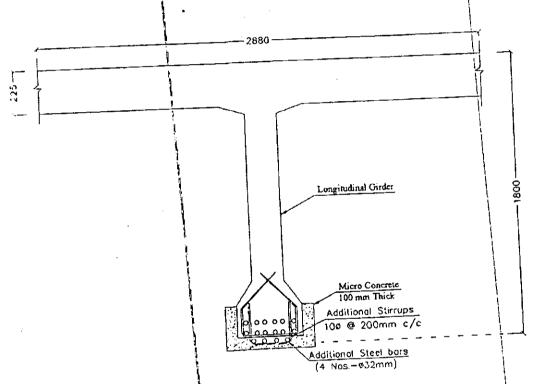


FIG. 8 FLEXURAL STRENGTHENING OF GIRDERS BY CONCRETE
JACKETING

FIG. 10 ADDITIONAL STEEL REINFORCEMENTS AT THE BOTTOM OF PIER CAP AND STIRRUPS

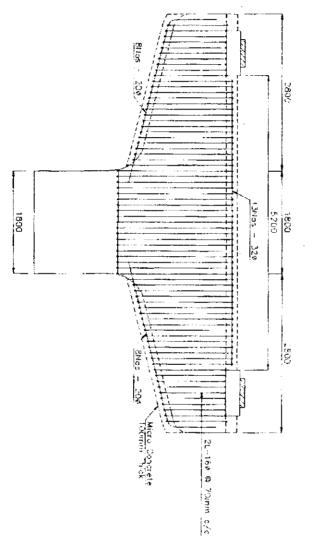


FIG. 9 ADDITIONAL STEEL REINFORCEMENTS AT THE TOP OF PIER CAP

#### 6.0 REPAIR AND STRENGTHENING OF PIER CAPS

The concrete substrate around the pier caps and on the top in between the pedestals have to be roughened using any suitable scarifiers. The loose concrete if any to be removed and the roughened surface be cleaned. 150 mm deep holes have to be drilled at a spacing of 350 mm c/c and 6 mm dia. 200 mm deep resin injection nozzles to be fixed using epoxy putty on the cracks. Low viscous epoxy vinyl ester resin has to be pumped under pressure till refusal. All resin injection nozzles have to be cut and scaled with epoxy mortar.

main reinforcements on the top of the pier cap by tack welding with the existing stirrup reinforcements. 8 nos. of 20 mm diameter bars of length 7.4 m have to be added with the existing main reinforcements on the bottom of the pier cap by tack welding with existing stirrup reinforcements. 2 legged 16 dia. stirrup reinforcements at a spacing of 70 mm c/c to be added on the pier cap above the additional main reinforcements. The stirrups on the additional steel reinforcement on the stem portion have to be anchored to the stem at both ends. After fixing all additional steel reinforcements on the pier cap in order, water tight shuttering has to be provided all around the pier cap. Microconcrete upto 100 mm thick has to be poured on the water tight shuttering. The shuttering has to be removed after three days. Proper curing has to be done as per the microconcrete manufacturers catalogue. The schematic diagram for repairing and strengthening of pier cap is shown in Figs. 9 and 10.

#### 8.0 SUMMARY AND RECOMMENDATIONS

Based on the non-destructive and partially destructive tests and analyses. HT Madras suggested to repair and strengthen the precast RC girders in seventeen standard spans and pier caps in eighteen piers P1 to P18. All precast RC girders to be strengthened for (i) flexure to enhance the effective moment of inertia and thereby reduce the deflection and (ii) shear to account for the increase in shear capacity due to flexural strengthening. The flexural, shear and flexural shear cracks on the girders to be arrested. The flexural and shear cracks in the Pier caps to be arrested. All Pier caps to be repaired and strengthened for both flexure and shear deficiency. The cracks on RC walls at the abutments to be repaired. The condition of pedestals and POT CUM PTFE bearings in the obligatory PSC girder (Center) span P9-P10 have to be checked and the pedestals to be repaired/recast and the bearings be replaced if needed.

IIT Madras explored the possibility of repairing and strengthening the precast RC girders using (i) Concrete jacketing, (ii) Steel jacketing, (iii) External flexural strengthening using CFRP composite pultruded sheets, (iv) Strengthening of girders by near surface mounting (NSM) technique using CFRP composite pultruded sheets, (v) Strengthening of girders by NSM technique using pultruded CFRP composite rebars and (vi) Shear strengthening using carbon fibre fabric composites. The possibility of repairing and strengthening the Piers using (i) Carbon fibre fabric composites and (ii) and Concrete jacketing are also explored. Considering the durability, cost and time to repair and strengthen the precast RC girders the following repair and strengthening scheme is recommended by IIT Madras:

- 8.1 Repairing of cracks in precast RC girders and pier caps by injecting low viscous resin,
- 8.2 Flexural strengthening of precast RC girders by concrete jacketing,
- 8.3 Shear strengthening of precast RC girders using carbon fiber fabric composites,
- 8.4 Cross stiffening of precast RC girders using standard steel sections and
- 8.5 Repairing of cracks on RC walls in the abutments.

The total estimated cost for the above mentioned scheme is Rs. 7.31 crores. IIT Madras will issue the execution drawings as per the requirement. Scaffolding, water supply and power supply have to be provided as per the site conditions by RBDCK/RDS. After repair and strengthening a span and two pier caps, a load test to be conducted and the measured deflection can be checked with the allowable limit to ensure the safety of the bridge. Strict

## 7.0 COST ESTIMATE TO REPAIR AND STRENGTHEN THE FLYOVER

7.1 Cost Estimate to Repair and Strengthen using NSM Technique

TABLE 1. REPAIR AND STRENGTHEN USING NSM TECHNIQUE

| SI. | Repair and Strengthening Item and Technique                          | Cost (Rs./Crores) |
|-----|--|-------------------|
| 1.  | Flexural strengthening of RC girders using CFRP composite rebars     | 4.61              |
| 2.  | Shear strengthening of RC girders using carbon fibre wrapping        | 1.48              |
| 3.  | Cross stiffening of RC precast girders using standard steel sections | 1.20              |
| 4.  | Repairing of cracks in the precast RC girders by resin injection     | 0.28              |
| 5.  | Repairing of cracks in the RC retaining walls at abutments           | 0.10              |
| 6   | Repair and strengthening of pier caps including the cracks           | 1.08              |
|     | Total  | 8.75              |

Total duration: 6 months

## 7.2 Cost Estimate to Repair and Strengthen Using Concrete Jacketing

TABLE 2. REPAIR AND STRENGTHEN USING CONCRETE JACKETING

|            |  | Cost         |
|------------|--|--------------|
| SI.<br>No. | Repair and Strengthening Item and Technique                          | (Rs./Crores) |
| 1.         | Flexural strengthening of precast RC girders by concrete jacketing   | 3.17         |
| 2.         | Shear strengthening of RC girders using carbon fibre wrapping        | 1.48         |
| 3.         | Cross stiffening of RC precast girders using standard steel sections | 1.20         |
| 4.         | Repairing of cracks in the precast RC girders by resin injection     | 0.28         |
| 5.         | Repairing of cracks in the RC retaining walls at abutments           | 0.10         |
| 6          | Repair and strengthening of pier caps including the cracks           | 1.08         |
| -          | Total  | 7.31         |

Total duration: 9 months

8ु426%=/2019/(D) PWD

quality control to be ensured during repair and strengthening of the Flyover. All safety procedures for manpower and machines to be ensured by the Applicators.

03.09.2019

Dr. P. ALAGUSUNDARAMOORTHY

Professor
Structural Engineering Laboratory
Civil Engineering Department
Indian Institute of Technology Madras
Chennal - 600 036, India

anualtino 32 slowed